



## How-To:

# Replace the Lytron G03, H03, and J03 Kodiak Keypad

### Safety Precautions:


- Always turn the unit “OFF” and unplug it from its power supply

### Required Tools:

- Philips screwdriver
- 5/16 socket wrench



## Procedure:

1. Remove the controller and display assembly panel. To remove the controller and display assembly, unscrew the four controllers-display assembly bracket screws. The arrows in picture 1 identify the locations of the fastening screws.


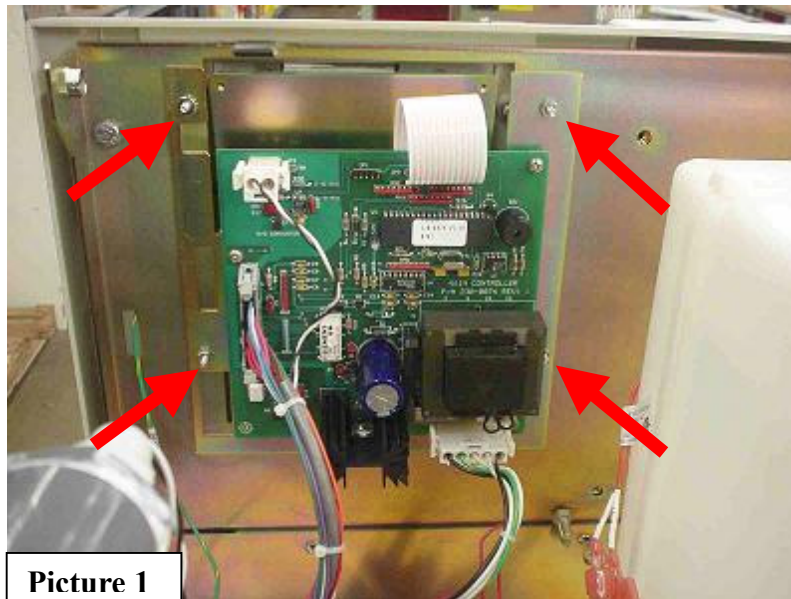


Picture 1

2. Remove the controller/display panel gently: The keypad assembly is connected to the controller/display assembly by a ribbon cable as shown in picture 2.
3. Disconnect this ribbon cable from the display assembly board, as shown by the arrow in picture 2.
4. Unscrew the keypad ground wire shown in picture 3.

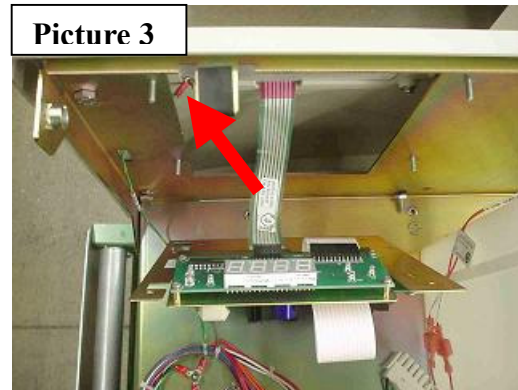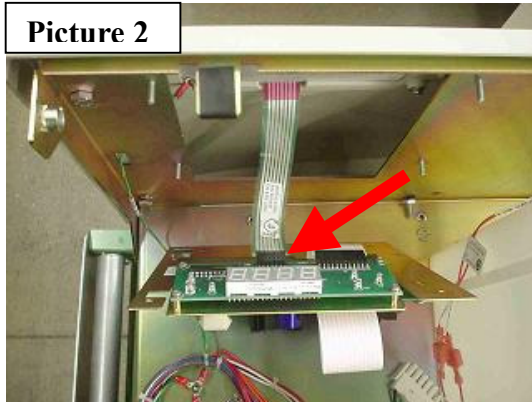

5. The front plastic panel needs to be removed to access the keypad. Unscrew the fastening screws, on the interior side of the chiller, as shown by the arrows in picture 4. Please note that RC006, RC011 and RC022 chillers will have four fastening screws, while RC030 and RC045 chillers will have six, as shown in picture 4
6. On the interior face of the front plastic panel, unscrew the four fastening screws, depicted by the arrows in picture 5. Push the Keypad forward to remove it.

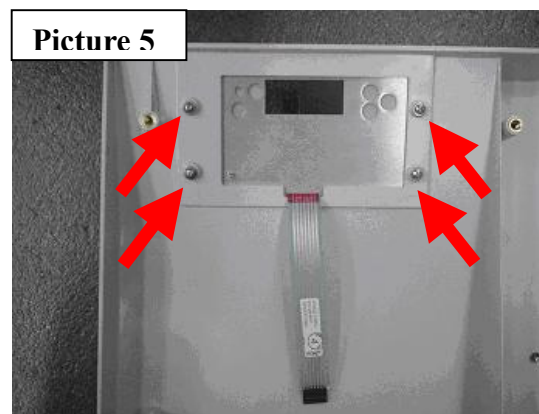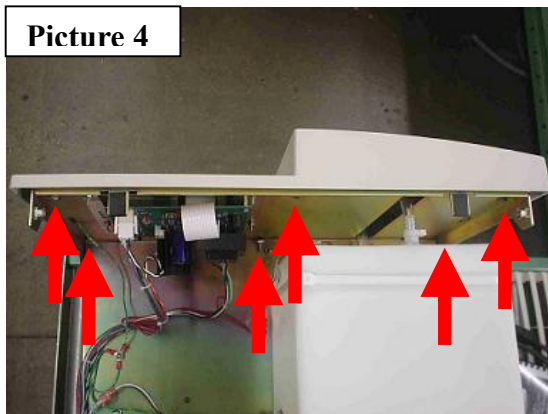

7. Replace the keypad and reassemble the chiller components (follow the above steps in reverse order).
8. Turn the chiller on and verify its proper operation.